


COMPONENTI KITANTERIORE	FRONTKIT COMPONENTS	COMPOSANTS KITANTERIEURE	COMPONENTES KITDELANTERO	G.P.L. L.P.G.	METANO C.N.G.
Riduttore	Converter	Vaporisateur	Reductor	LE/LSEM	LMEM
Commutatore	Petrol start switch	Commutateur	Conmutador	C97-L / P97	
avviamento a benzina		demarrage essence	arranque a gasolina		
Lambda Ecologic System	Lambda Ecologic System	Lambda Ecologic System	Lambda Ecologic System	LES 95 o 98	
Elettrovalvola G.P.L.	LPG solenoid valve	Electrovanne GPL	Electroválvula GLP	EV2	-
Sensore manometro metano	CNG sensor and manometer	Capteur pression Methane	Sensor de GNC y manómetro -		805i
Miscelatore	Mixer	Melangeur	Mezclador	-	-
Emulatore staccainiettori	Injectors simulator	Emulateur injecteurs	Simulador de inyectores	BMW (451)	

SCHEMA ELETTRICO - WIRING DIAGRAM - SCHEMA ELECTRIQUE - SCHEMA ELECTRICO

27.12.95

Centralina d'iniezione
ECU
Centrale d'injection
Modulo central de inyección

LANDI
Reggio Emilia Italy
L.E.S.

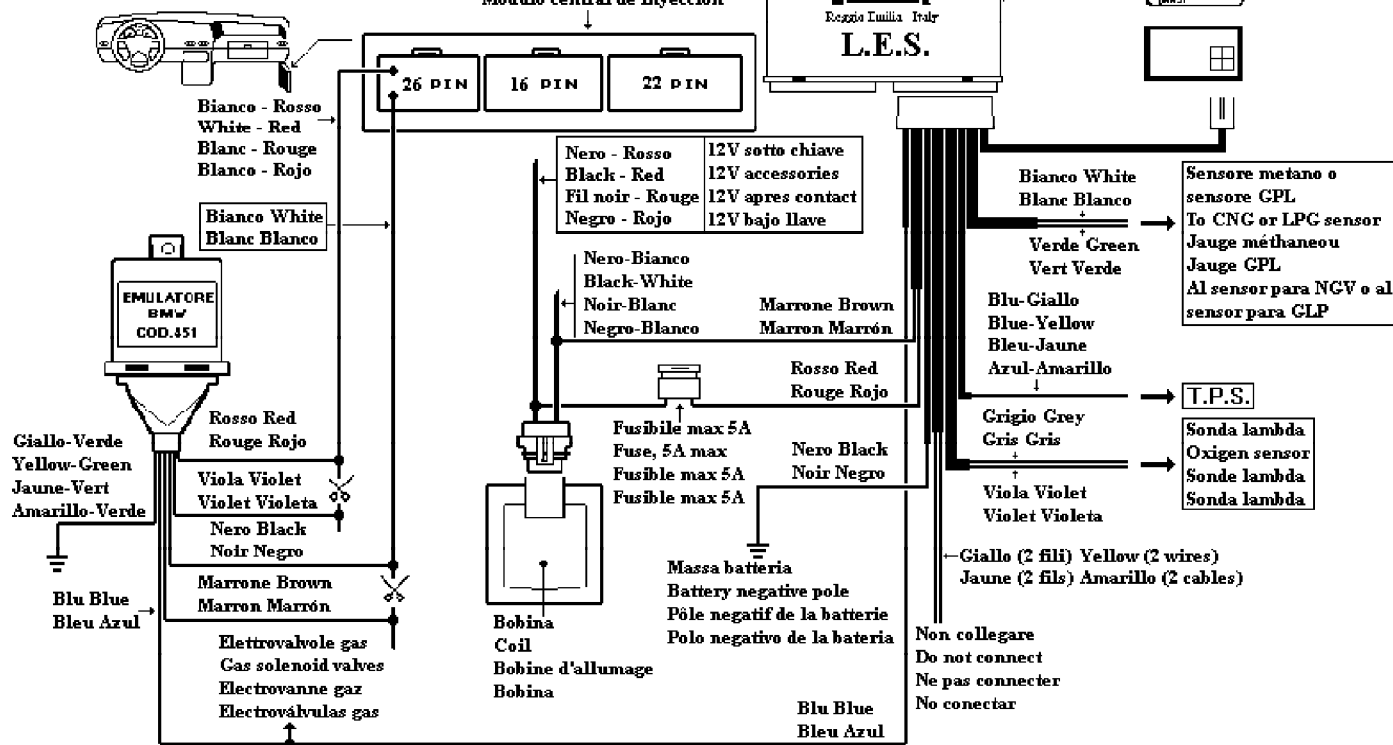

NOTE

- Sonda Lambda a 3 fili. Segnale sul filo nero.
- Segnale T.P.S. sul filo n° 14, giallo
- Fissare la massa del L.E.S. sul polo negativo della batteria.
- Scollegare la batteria prima di effettuare qualsiasi operazione.
- Saldare le connessioni elettriche.
- Non utilizzare rubacorrente

MATERIALE CONSIGLIATO

- Set tubazioni e raccorderie

NOTES

- 3 wires Oxygen sensor. Signal is on the black wire.
- T.P.S. signal is on wire #14, yellow.
- Connect L.E.S. ground to the battery negative pole.
- Disconnect the battery before working.
- Soft solder wiring connections.
- Do not use fast-connections

OTHER SUGGESTED MATERIAL

- Pipes and fitting set

NOTES

- Sonde lambda à 3 fils. Signal sur fil noir.
- Signal TPS sur fil jaune.
- Fixer la masse du LES sur le pôle négatif de la batterie.
- Déconnecter la batterie avant d'effectuer n'importe quelle opération.
- Souder les connexions électriques.
- Ne pas utiliser de connexions rapides.

MATERIEL CONSEILLE

- Kit tuyaux et raccords

NOTAS

- Sonda Lambda con 3 cables. señal en el cable negro
- Señal T.P.S. en el cable amarillo
- Fijar la masa del LES en el polo negativo de la batería.
- Desconectar la batería antes de efectuar cualquier operación
- Soldar las conexiones eléctricas
- No utilizar conexiones rápidas

MATERIA ADICIONAL

ACONSEJADO

- Set cañerías y racores